

STAR Case



Case Number: S1208000174

Release Date: 05/03/2012

Symptom/Vehicle Issue:


No Start Or Slow Start When Cold, Click No Start

Diagnosis:

No start or click no start complaints; may have MIL lamp and or battery lamp on. Some recent reports indicate that the B+ battery cable connections from battery to the front TIPM may create this condition.

Repair Procedure:

Inspect for poor connections or dirty battery cables from the rear battery to the front TIPM. The B+ battery cable has an interior bulkhead terminal connection. This connection point is located under the front passenger carpet. Some reports have located this connection point as the area of concern. Clean and or replace this terminal as needed.

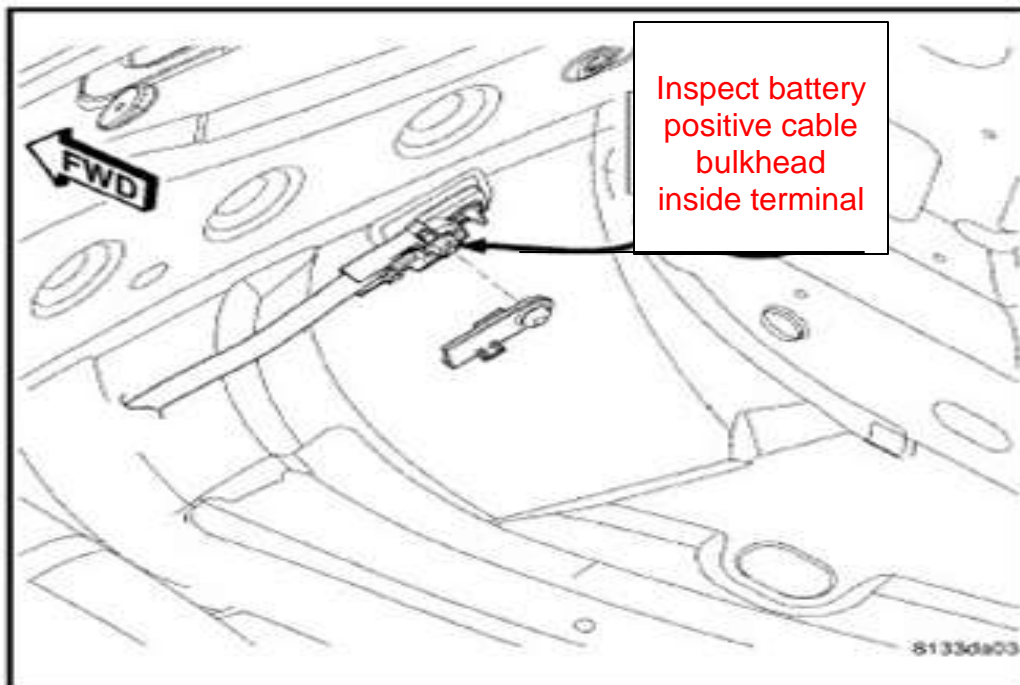

Verification:

Perform the diagnosis and testing battery cables procedure as needed to complete.

[Contact the STAR Center for assistance if no solution is found](#)